

B

(C)

ASSEMBLY INSTRUCTION

TINY xIr | Cable Connector - RT*FC-B & RT*FC-B-W



- (A) Slide the rubber sealing (1) (RT*FC-B-W only) and the boot (2) onto the cable.
- (B) Prepare cable as shown.
- © Insert wires into the terminals and solder them.
- Apply the groundring to the cable and position it on the insert.Attention: Pay attention to the key.
- (E) Grounding Option: Ground with housing, solder #1 to the solder lug of the groundring.



F Put chuck onto the cable.

Attention: Pay attention to the guiding key.

Black chuck: O.D. 2.0 - 3.5 mm Blue chuck: O.D. 3.0 - 4.5 mm

- G Slide insert and chuck together into the housing.
- (H) Screw the bushing onto the connector. The RT*FC-B type is ready.












Rubber sealing assembly on page 2.



SINGLE BAG PACKAGING:


The rubber sealing can be easily applied by hand.

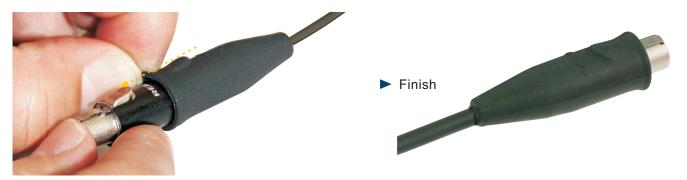

Attention: Pay attention to the position of the latch (see the picture).

BULK PACKAGING:

For large quantity assemblies an assembly hose is supplied with bulk packaging (-D).

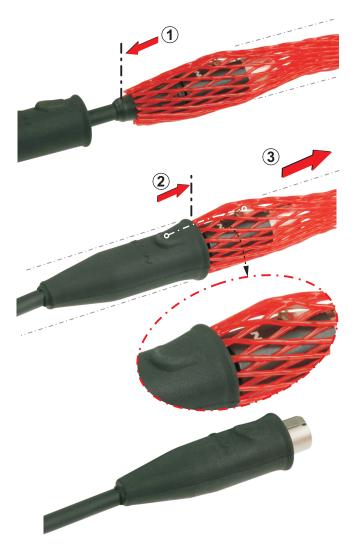

- 1 Put the assembly hose onto the connector over the end of the boot (as shown in picture).
- (2) Push the rubber sealing onto the assembly

Attention: Pay attention to the position of the latch (see the picture).

(3) Hold the cable and pull the assembly tool jerkily off the connector (the sealing jacket is pulled in position).

Finish

NEUTRIK AG NEUTRIK USA Inc. NEUTRIK (UK) Ltd. NEUTRIK Vertriebs GmbH

USA UK T: +44 1983 / 811 441 DE/NL/AT/DK T: +49 8131 / 280 890

T: +423 / 237 24 24 F: +423/232 53 93 T: +1 704 / 972 3050 F: +1 704 / 438 9202 F: +44 1983 / 811 439

F: +49 8131 / 280 830

NEUTRIK France NEUTRIK Tokyo Ltd. NEUTRIK Hong Kong Ltd. HK T: +33 1 / 4131 6750 T: +81 3 / 3663 4733 T: +852 / 2687 6055

F: +33 1 / 4131 0511 F: +81 3 / 3663 4796 F: +852 / 2687 6052

Draft. Nr.: BDA 260 / 3102M1801 | Update: 08.04.2012 | Data subject to change without prior notice. © 2012 NEUTRIK* .ALL RIGHTS RESERVED.